

İTALYA LİMANLARINDA TÜRK BAYRAKLI GEMİLERDE 2022-2025 YILLARI ARASINDA TESPİT EDİLEN EKSİKLİKLER
(Tutulma maddeleri Gri Renkli olarak verilmiştir)

DENETİM LİMANI	DENETİM TARİHİ	NO	REFERANS	EKSİKLİK
RAVENNA	05.01.2022	1	MLC	3 mooring ropes in bad condition.
		2	ISPS	Missing evidence of security drills carried out in the last 3 months, missing evidence of security exercises carried out since 01/2020
		3	MLC	Shipboard working arrangements table not properly filled.
		4	CIII R37	The muster list doesn't specify subston for key persons.
	01.03.2022	1	MLC	Medical certificate of 2nd officer found not properly filled (indication "engine" instead of "deck")
		2	MLC	SEA of 3rd eng. And cook found with expiring date 01.03.2022 (employed for determinated period of 4 months). Furthermore found 1) "oiler" with SEA for "electrician" (electrician not compulsory for ship in accordance with MSM) 2) "Engine cadet" with SEA for Oiler.
		3	CII-II	Fire door in provision store (upper deck) found blocked with hook and with incorrect placard, not in accordance with ship's firePlan (indication of "B class hinged fire door" – yellow placard, instead of "A class hinged fire door" – red placard)
	02.05.2022	1	ISPS	Access control to ship not as required. Crew member on duty at gangway didn't checked ID cards of PSCO's at boarding.
		2	CIII	No.4 lifebuoys of 8 didn't found in stowed position in accordance with ship's LSA plan(missing). Furthermore, IMO symbol missing.
		3	MLC	Cleanliness of Engine Room not as require. Found minor leakage of oil from M/E (cyl no 6)
		4	ICLL AN 1	Weathertight door on Bridge deck found blocked with rope (not with clamping devices or other equivalent means attached to the bulkhead.)
		5	CIII R20	Rescue boat found not hooked to ship's david.
		6	CIII	Emergency instructions for Rescue Boat operations found not readable (not easily seen under emg lighting condition)
		7	CII-2	Auxiliary engine not as required. Hot water heater's steel cover found deformed (top part).
	22.08.2022	1	MLC	Protective eye solutions missing in paint room and battery room.
		2	ISPS	Access control to ship not as required. At embarkation of PSCO, no ID-check was carried out.
		3	CII-2 R14.1	One head of sprinkler system in paint room (STB side) found obstructed by paint's bins. Not functional for its purpose.
		4	MLC	Cleanliness of E/R not as required. Found minor leakages of oil from ME (cyl no 3-4-5), under termo oil pumps and purifiers MGO.
		5	CII-2 R14.1	Fire door (A-class) of electric store didn't close properly due to handle's problem.
		6	MLC	Detected excessive presence of water under air condition system (in air condition room). Furthermore, found condensate water Collection bucket in Engine Control Room next to High voltage panel. Unsafe.
		7	CIII	Abondonship drill not dully carried out: lack of communication between crew (missing taking SART's EPIRB, rockets and flares). Master instructed to put in place additional briefing and drill before departure.

RAVENNA	25.08.2022	1	CIII R9.2.2	Emg instructions for liferaft (PS) not easily seen under emg lighting conditions (light obstructes from pipeline)
		2	CII R14.1	Two self closing fire doors in E/R didn't close properly. (Purifier room/ME floor exit). Furthermore, one fire door behind ER found blocked by small bolt.
		3	MLC	Cleanlines of Engine Room not as required. Detected minor leakages of oil from M/E (Cyl no1 next to fuel oil leakage alarm, and cyl no 3). Furthermore found minor leakages of oil from filter of FO purifier.)
		4	CVI IBC 19	Shipping documents of loading port (Braile/Romania) reports wrong information about Cargo viscosity at 20 degree C reported "68 instead of "30". Master instructed to put in place briefing with officers in order to improve controls of Shipping documents.
		5	MARPOL	Cargo record book not properly filled: missing indication to discharge rate during discharge in to the sea of tank washing "F" on
		6	MLC	Thermometers of freezing for vegetables and fish found out of order.
	09.09.2022	1	MLC A4.3	Engine room found severely dirty, found oil leakages everywhere (auxilaiary engines, purifier room, propeller pitch hyroulic pump etc) Especially were found huge oil leakages from fuel oil shock pump/automatic filter, DO seperator & LO seoperator). The Working environment of engine room is absolutely substandart.
		2	II-2 R14.2	2 self closing fire doors in accommodation not properly closing.
		3	II-1 R29	Minor oil leakages from Steering gear.
		4	MARPOL	Engineers not familiar with OWS 15 ppm test.
		5	II-1 R43	2 emg lights ST besids Cargo holds found inoperative.
		6	CIII R9	Operating instructions for liferafts PS&Forward not in working language.
		7	CII R14.2	Hydroulic oil pipe broken during test of funnel's dampers: oil spil on B deck.
		8	MLC A4.3	Oil leakages from PS forward winch and hydroulic pump in forecastle.
		9	CIII R20	IMO label missing for one lifebuoy PS midship.
		10	MLC	Missing eyewash solution in paint locker.
		11	CV R27	The last Notice to Mariners on board was not the last one published by the Admiralty (week 31 found on board) not up to date.
		12	C5 R27	Nautical charts no 220 and 200 not up to date.
		13	C IV R17	In the GMDSS radio log book there is no evidence of the montly test carried out by the crew. Furthermore missing entries for the Daily tests of the 07.09 and 08.09.
		14	MLC A3.1	Common toilet on the fourth floor found dirty and with the toilet flushing device broken. Furthermore the shower was found inoperative and without courtain. The showers of the bosun cabin and of the common toilet of A deck STBs were found withouts curtains. Not hygienic.
		15	MLC A 3.2	No thermometer was found inside the fridge and freezer of the messroom. It was impossible to determine the temperature.
		16	C III R35	In the SOLAS training manual missing evidence of the procedure for the use of helicopter rescue gear (slings, baskets, stratchers), breeches buoy and shore lifesaving apparatus and ship's line throwing apparatus.
		17	MLC A4.3	Missing protection devices fort he lathe machine & drill press in ER workshop.
		18	MLC A.4.1	During abondon ship drill one crew member didn't wear safety shoes.
		19	STCW	During drill in ER, Engine crew has not a ready familisation with alarm systems.

	28.09.2022	1	CII-2R14.2	Emergency fire pump not properly working, it started without giving enough pressure to fire line.
		2	CII-2R14.2	Fire line found holed ST midship.
		3	CIII R 37	Muster list doesn't specify the following duties: closing of the WT doors, fire doors, valves, scuppers, side scuttles, skylights, port holes and other similar openings in the ship. Furthermore in abandonment duties aren't specified crewmembers in charge of launching liferafts; furthermore aren't specified to ensure that life saving and fire appliances are maintained in good condition and are ready for immediate use, and also substitutes for key persons who may become disabled.
		4	CIII R20	Missing evidence of 5 yearly service for lifeboats, furthermore remote control wire broken during lowering of ST Lifeboat.
		5	CIII R19	During abandonment ship drill the crew wasn't properly mustered and showed a lack of communication (the crew went to a first wrong muster station) and a very lack of training on lowering ST lifeboat; the remote control wire broken, the lifeboat's wires turned around and blocked the lifeboat lowered, were necessary a lot of attempts to release the wires enough to heave up again the LB.
		6	CV R34	Last voyage plan not berth to berth.
		7	CII R19	During the fire drill the crew showed a lack of training and a lack of communication: the cook remained inside the fire's scenario (galley) not aware of the drill in progress; furthermore the galley wasn't insulated (door kept open), the fireman didn't wear Breathing apparatus and entered the fire's scenario without using a fire hose or fire extinguisher, just holding a torch.
		8	CV R26	Missing evidence of steering gear drills carried out.
		9	CV R 27	Some nautical charts used during last voyage (no 204,220, 1467, 1445) not updated.
		10	MLC A4.3	Oil leakages from aux engines, no 1&2 purifiers, LO purifier, no 1&2 air compressors, FO transfer pump, No 1&2 circulating pumps, No1 FO booster pump. Furthermore bilge wells to be cleaned.
		11	CIII R20	Missing evidence of Solas type approval for 4 lifebuoys, furthermore 3 lifebuoys's lights inoperative, furthermore IMO symbol missing for 1 lifebuoy.
		12	MARPPOL	OWS inoperative, test failed. Furthermore calibration certificate missing.
		13	CII-2 R14	Galley's exhaust duct found greasy and dirty of oil.
		14	CIII R20	Missing lights on lifejackets of 2nd officer, bosun and one AB
		15	CII-1 R26	Boiler found inoperative.
		16	MLC A3.1	All common sanitary facilities and showers found not properly maintained, very dirty, not hygienic. Furthermore one shower's head missing; furthermore hot water not available on board.
		17	MLC A3.2	Cold rooms to be maintained. Furthermore thermometers missing.
		18	MLC	Missing drying machines or adequately heated and ventilated drying room.
		19	CII-2 R7.2	Missing evidence that fixed fire detection and fire alarm system is of an approved type.
		20	CII-1 R43	Emergency DG not properly working. It started without supplying power; furthermore external emergency lighting close to the bridge inoperative also with main power supply.
		21	MARPOL	NOX technical files for aux engines missing on board.
		22	MARPOL	Garbage record book not properly filled in: several times isn't specified the quantity for each category of garbage delivered ashore; incinerated or food waste disposed at sea.

RAVENNA		23	STCW	Missing Flag State endorsement of GOC IV for Chief Officer.
		24	MARPOL	Oil record book not properly filled. (Records by mistake)
		25	MLC	SEA of donkeyman not properly filled, total montly pay doesn't match with the sum of basic wage, fixed overtime, leave pay.
		26	CIII R17.1	Missing ob board Ship Specific Plans for the Recovery of Persons from the Water.
		27	ISPS Kod	Visitor's log book not as required. Possible to fill only name of visitor. Date&signature, missing purpose of the visit, n. ID card.
		28	ISPS	Missing records and detailes of additional security measures put in place in the port of Kandia/India on 06-07.09.2022 that was marsec level 2 according to ISPS ship pre-arrival security informaation form.
		29	ISPS	Missing records of maintenance, calibration and testing of security equipment.
		30	CIII R20	Missing weekly records of LSA maintenance since july 2022.
		31	CV R27	ITU list V (List of ship stations) 2021 found on board.
		32	CII-2 R14.1	Missing weekly records FF equipment maintenance since july 2022.
		33	MARPOL	SOPEP, List of authorities or persons to be conducted in the event of an oil pollution incident not updated.
		34	MLC A4.3	Both winches of Crane no 3 found rusty & not properly maitanead.
		35	MLC A4.3	Missing protection devices for drill press, lathe machine&grinder in ER workshop.
		36	SOLAS CIII	LSA training manual incomplete, missing some instructions (E.G. methods, and use of devices for protection in launching areas, illumination in launching areas, use of drogues, use of engine and accessories, instruction for emg repair of the LSA.)
	04.10.2022	1	CIII R35	LSA training manual incomplete, not properly specified the following instructions; methods and use of devices for protection in launching areas; use of all survival equipment, use of drogues; hazards of exposure and the need for warm clothing; recovery of survival craft and rescue boats including stowage and securing, methods of retrieval, including the use of helicopter rescue gear (slings, baskets, stretchers), breeches buoyand shore life-saving apparatus and ships line throwing apparatus.
		2	CIII R37	Muster list incomplete, not properly specified the following duties: starting fire pumps, launching of liferafts.
		3	CIII R19	During fire drills the crew showed a lack of training and a lack of communication: fire's scenario wasn't understood by all crew members and fireman no 1 was OS 2 instead of AB 2 as required by muster list.
		4	MARPOL	Engineers not familiar with Oil Filtering Equipment.
		5	MLC A4.3	Cleanlines of ER not as required. Oil leakages from both air compressors.
		6	CII-2 R14.2	Some self closing fire doors in accommodation found not properly closing.
		7	CIII R17.1	Plans for the Recovery of Persons from the Water not ship specific.
		8	STCW	Hours of rest for cook and steward are divided into more than two periods.
		9	ISPS	Missing records and details of aditional security measures put in place in the port of Odessa/Ukraine on 11-14.09.2022, Taman/Russia on 09-11.08.2022, Nova/Russia on 16-18.07.2022 and Tuapse/Russia on 19-22.06.2022 that were at marsec level 2 according to ISPS ship pre-arrival security information form.
		10	ISPS	Access control to ship not as required: visitor badge wasn't given to PSCO.

RAVENNA		11	ISPS	Security contact list not as required: missing contact details of PFSO of Docs Cereali terminal in Ravenna Port.
		12	MLC	Private sanitary facilities floor of 3rd engineer to be maintained.
		13	MLC	Missing protection devices for drill press & lathe machine in ER workshop.
		14	MLC	Meat cold room to be maintained.
	12.06.2023	1	MARPOL REG.17	Oil record book not updated: last records reported 17 mc in bilge water holding tank (sounded 23), 1 mc in sludge tank (sounded 3,3) and 10 mc in purifier sludge tank (sounded 9) last bilge/sludge transfer operations not yet recorded.
		2	MARPOL REG.4	Found excessive amount of special garbage retained on board (drums, cans. oxygen bottles, acetylene bottles, operational waste) stowed in poop deck, engine room, steering gear room, ER workshop, ER changing room, outside the bridge): to be disposed at the next available reception facility
		3	ICLL REG.10	Stability information booklet approved by RO but is missing evidence of approval on behalf of Administration
		4	SOLAS	Cargo securing manual approved by RO but is missing evidence of approval on behalf of Administration
		5	MLC	WC flush inoperative in the hospital & cabin n. 204
		6	SOLAS	Gyro compass repeaters not properly working: on the bridge & steering gear room is 20°, on PS bridge wing is 310°, on STS bridge wing is 140°
		7	SOLAS	Operating instructions (poster) for lowering STS liferaft & rescue boat only in english while working language on board is Turkish
		8	MLC	Corridor's floor close to ER entrance to be maintained.
		9	SOLAS	Plans for the recovery of persons from the water not ship specific
		10	ISPS CODE	Access control to ship not as required: no visitor's badge was given to PSCO
		11	SOLAS	Fire fighters' outfit are fire proximity only and may not provide the wearer a sufficient thermal protection from radiated heat if entering an enclosed space where a fire is established (e.g. in the galley, where was carried out the fire drill)
	21.09.2023	1	SOLAS/CH. II-2/REG.10	Last two fire drill carried out in galley and in chemical store (AGO-SEP 2023). Fire fighting outfits on board are fire proximity suits type and may not provide the wearer sufficient thermal protection from radiated heat if entering an enclosed space including machinery and accommodation spaces where a fire is established. Close proximity clothing may be freely used for protection when boundary cooling fires or for search and rescue in an enclosed space without a fire. Use of appropriate fireman suits to be included in the fire training manual.
		2	SOLAS/CH. II-1/REG.21	The self-priming/vacuum units, installed on the pumps connected to the engine room bilge pumping arrangements (Fire & Bilge pumps), found inoperative when tested. The drive wheel of the priming units is not moving horizontally when pressure on the discharge increases or decreases. Anyway pumps tested in manual mode with satisfactory results.
		3	SOLAS	It was noticed a minor cooling water leakage from cyl. no. 6 of M/E.
		4	SOLAS/CH. II-1/R.26	Following pressure gauges found unreadable: 1) suction gauge of no. 2 D/G F/O booster pump; 2) cooling water pressure of D/G no. 3; 3) calorifier unit CFL-2000-S (gauge in the middle, missing any label also).
		5	SOLAS/CH. II-2/R.14	It was noticed insulation's damages of 1) GMDSS battery room (ceiling); 2) cold room entrance area (A-class bulkhead on the left); 3) pipes/ducts behind air condition machine in air cond. room.

		6	MLC/TITLE 3/STD. A3.1	The galley floor in general (expecially souppers) need additional cleaning operation. Furthermore, it was noticed excessive presence of flies. Not hygienic.
		7	SOLAS/R.37	Muster list found without assigned person/s to closing of the fire doors, valves, sidescuttles, skylights, portholes and other similar openings in the ship.
RAVENNA	07.08.2024	1	SOLAS CH.III	LSA records of maintenance incomplete missing: diagram of lubrication points with the recommended lubricants; list of replaceable parts, list of sources of spare parts
		2	MARPOL ANNEX I	SOPEP approved by RO but is missing evidence of approval on behalf of Administration
		3	SOLAS CH.III	LSA training manual incomplete, missing the following instructions: methods and use of devices for protection in launching areas; illumination in launching areas; recovery of survival craft and rescue boats including stowage and securing; methods of retrieval, including the use of helicopter rescue gear (slings, baskets, stretchers), breeches-buoy and shore life-saving apparatus and ship's line-throwing apparatus; instructions for emergency repair of the life-saving appliances
		4	MLC TITLE 1	medical certificate of oiler C.F. not properly filled in: results fit for duty for
		5	SOLAS CH. II-2	FF training manual incomplete, no mention about escape systems and appliances
		6	MLC TITLE 3	almost all cabins need maintenance; e.g. several mattresses found very dirty and in bad conditions (cabins n. 10,13, 19,43,44); some ceiling lights' covers missing (cabins n. 19,41,43); several pan air diffusers missing or damaged (cabins n. 13,15,41,42,48,49); furthermore ceiling damaged in cabin n. 44, floor damaged in cabin n. 13, bed's light detached in cabin n. 42
		7	MLC TITLE 3	several sanitary facilities found in bad conditions, expecially common SF close to aundry room found very dirty with floor damaged, one WC inoperative, sink damaged and shower's floor to be maintained; furthermore floor of SF in the cabins n. 9,13.14 & 15 found in bad conditions and WC close to the bridge found inoperative
		8	SOLAS CH.II-2	missing self closing device on galley's fire door
		9	MLC TITLE- 3	Foor of both laundry rooms found dirty and damaged; in the biggest laundry room the Moor is also partially flooded and drying machine found inoperative
		10	SOLAS CH.II-2	isolation valve in main fire line found inoperative
		11	MLC TITLE- 3	dry provision and vegetable rooms found dirty and in bad conditions, expecially in dry provision room ceiling and walls found damaged
		12	SOLAS CH.II-1	UMS alarms in the cabins of chief engineer and second engineer are only visible on the panel but not audible
		13	SOLAS CH.II-1	hydraulic starting system of em'cy DG not ready for use
		14	MLC TITLE- 4	oil leakages from CPP oil pump (shaff): furthermore minor oil leakages from purifiers

RAVENNA	07.08.2024	15	MLC TITLE-3	some bread in provision store found in bad conditions
		16	SOLAS CH.III	rescue boat inventory not as required: waterproof electric torch inoperative; whistle or equivalent sound signal and bucket missing; first aid kit expired on june 2024
		17	MARPOL ANNEX V	excessive amount of garbage retained on board
		18	MARPOL ANNEX 1	ail record book not properly filled in: leak tank's capacity is recorded cm 1,7 instead of cm 1.77 as per IOPP supplement
		19	SOLAS CH.III	at the time of first inspection, during fire drill the crew showed a lack of training fireman didn't use two-way radiotelephone apparatus and lost his axe; furthermore drill's scenario (galley) wasn't properly insulated (door kept open). During second inspection another fire drill was carried out with satisfactory results
		20	SOLAS CH.III	one lifebuoy aft found without RR bands; another lifebuoy aft found with light inoperative; furthermore missing evidence that MOB lifebuoys are Solas type approved and have a mass of not less than 4 kg
		21	SOLAS CH. II.2	ER dampers on open deck PS & STS found damaged and not properly closing
		22	MLC TITLE 3	galley found dirty and in bad conditions, furniture damaged
		23	SOLAS CH.IX/REG. 3	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiency(s) marked ISM is (are) objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.
TRIESTE	10.01.2022	1	CII-2 20.6	Water spray system for Ro-Ro Cargo spaces (Upper deck – section no:6) : no 3 heads clogged.
	19.01.2022	1	MLC 4.3	Lathe machine, grinder and drill press: emergency stop device (foot switch) missing.
		2	CV R27	At the time of the inspection NP 47 (Admiralty e-publication-Med pilot vol 4) was not available on board.
	27.01.2022	1	CII-2 R4.4	Plastic bins found in galley for all types of garbages not as required.
	31.08.2022	1	MLC	Air Condition plant, filtrs found dirty.
	01.09.2022	1	MLC	Accommodation Air Condition plant, filters missing.
	08/02/2023	1	MARPOL An.I-19 R.17	Bilge operation 04 Feb 2023 recorded under Code C instead of Code D
		2	SOLAS Ch-II-2 08 Amend. R.20.6.1.5	Means to prevent the blockage of drainage arrangements not provided on vehicles and RO-RO spaces. A clearly visible sign or marking “Drain opening- do not cover or obstruct” not as required.
		3	SOLAS Ch-II-2. R.14.1	3 heads of drencher system on whether deck, during the test, found inoperative.
	11.10.2024	1	ISPS CODE	Some restricted areeas left opened during cargo operations.
		2	ISPS CODE	Visitor logbook not properly filled in and nobody checked PSCOs document
		3	SOLAS	Form n. 2 and 3 attached to CSR n. 5 not filled properly, missing information that have been changed from CSR n. 4
		4	MLC 2006	Missing protection for gander in Bosun store.

		5	MLC 2006	Missing pan air diffuser in cabins nr. 8, 10 & 14
		6	SOLAS CH. V	Voyage plans for previous and next port filled in with wrong number of nautical charts. Voyage plans for previous and next port not signed by master.
		7	SOLAS CH. III	During FD carried out in galley: some crew member entered into the scenario without wearing FF outfit; lack of communication between fire men and team leader/master, door of galley left open, crew members showed lack of knowledge
		8	MARPOL	Several barrells of oil stowed in main deck.
		9	ISM CODE	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiency(s) marked ISM is (are) objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.
VENICE	10.01.2022	1	CII-2 R14.2	An oxgen cylinder used during the fire drill is not adequately controlled (Indicator shows low cylldr condition-buzzer activated).
		2	MLC	An insufficient quantity of food was detected in the food storage cells. (not compatible with the number of crew members in relation to the duration of the next voyage Constanta. There is no evidence of an order placed in the port of inspection.
		3	CV	The passage plan drawn up for navigation from Ravenna to Margera (last voyage) reports completely incorrect information.
		4	MARPOL	OWS 15 ppm alarm arrangement no tproperly tested.
		5	MLC	Some Seafarers Employment Aggreements (SEA) not as required.
	10.07.2022	1	LL R14	A wheel of the starboard side of the hatchcover of hold no. 4 has the profile visibly damaged and corroded by rust.
		2	CII-2 R14.1	The pressure indicator of the suction line of the Emergency Fire Pump (installed in the EFP room) is not functional. There is another similar meter installed on the line, functioning.
		3	CII-2 14.1	A nozzle of the paint room fire sprinkler system is partially obstructed. Furthermore, the paint cans positioned on the highest shelf of the shelf obstruct the correct distribution of the water jet.
		4	CII-1 R40	A control panel of the ECR shows a risk alarm of missed / precarious electrical insulation of the equipment.
		5	CIII R13	Freefall pyrotechnic distress signals are incomplete (3 signals and 3 parachute signals are in bridge, in a dedicated container and marked with "free fall pyrotechnics")
		6	CV R12	Deviation difference recorded between the compass and the gyrocompass is not compatible with the deviation data shown in the relevant table.
	23.09.2023	1	MLC/STD. A2.1	There is documentary evidence that the Bosun SEA is extended for a period exceeding 11 months (starting 12.22.2022, extension on 08.21.2023 until 04.21.2022). Master instructed to regularize the duration of the contract before departure.
		2	SOLAS/R.20	Water leakage from the Freefall closing door (waterlight test performed)
		3	SOLAS/R.45	The electrical contact of the oil leakage sensor is improper (insulation and connection precarious). The system is operational.
	05.11.2023	1	SOLAS/R.20	Portside LB lowering system safety lock holding handle is heavily rusted and corroded
		2	SOLAS/R.14	A clear and significant quantity of oil was noticed near the high pressure injection of the FO on cylinder no. 4
		3	SOLAS/R.17	The specific plan for the recovery of people from the sea is generic (the list of equipment present is not detailed as requested)

	24.06.2024	1	SOLAS CH. III	Functional test of ready operation of the rescue boat showed some difficulties in rapid and effective use (failure to use restraining and control lines, difficult positioning of the RB during the test, delay in launching). Master instructed to carry out additional training over the next 14 days
		2	SOLAS CH.II-1	The door closing control panel in bridge shows a malfunction alarm
		3	SOLAS CH.III	The annex with the description of the specific equipment (indicated in the summary) is missing
		4	SOLAS CH.II-1	the DDGGs show some oil leakage coming from the gaskets and joints of the parts.
PIOM BINO	24.02.2022	1	MLC	The refrigerator room are not clean, there is a lot of ice on tubes.
		2	MLC	Galley, the sink are broken.
		3	CIII R20	During the abandonship drill the port side lifeboat is not ready to use.

MOLFETTA	21.03.2022	1	ISPS	ID card not checked and visitor badge not delivered during access on board.
		2	SOLAS CIII	The batteries used for VHF GMDSS are not equipped with a non-replaceable seal to indicate that it has not been used.
		3	MLC 2006	C/E has Employment agreement with wrong entries. (The rank is A/B, date of contract)
		4	MLC 2006	Hospital sickbay accommodation is used as storage room for paper box, water and soft drink.
		5	SOLAS CII-2	A fire hose on bridge deck found leaking on its connection (Def. recorded also on 24.11.2021 is not rectified as per PSC request)
		6	SOLAS CII-2 R15.2	During the fire drill the fireman didn't use the breathing apparatus correctly and showed poor communication with team leader (Def recorded also on 24.11.2021 is not rectified as per PSC request.)
		7	MLC 2006	One thermometer found inoperative for one freezer.
		8	SOLAS CI	Safety Equipment Certificate found on board not in original.
		9	STCW	Ch.Eng has a medical certificate expired on 17.12.2021.
ORISTANO	12.04.2022	1	SOLAS CII-1	RPM Indicator Emergency Generator was found out of order.
		2	MLC	Ship not equipped with sufficient air conditioning (cooling) for seafarers accommodation, cabins and other common spaces.

AUGUSTA	21.04.2022	1	SOLAS II-1 R43	Emergency generator simulated black out failed. ACB not closing (automatic or manuel, too) Emergency consumers without power in black out.
SAVONA	17.05.2022	1	SOLAS CII-2	Two two-way portable radiotelephone apparatus for each fire party for firefighter's communication missing (during fire drill the crew used the GMDSS VHF apparatus).
		2	SOLAS CIII	Rescue boat's engine started after several manouvers.
		3	MARPOL ANI	It is not possible to conduct OWS test due to a malfunction of the system.
		4	SOLAS CII-2	Emergency escape from forecastle store space found closed by grid fixed with bolt and two nuts.
		5	SOLAS CII-2	Fire drill failed (i.e. fire team was unable to communicate with team leader, fire zone was not poperly isolate.
		6	MARPOL	In the IOPP supplement certificate missing the indication of the ship's "date of major conversion" (10.12.1998).
		7	SOLAS CIII	Rescue boat, during the lowering at sea level water of the rescue boat, a handrail was broken
		8	MLC 2006	Some soft drink in dry store were found mixed with cleaning materials
		9	SOLAS CIII R20	Containers, brackets, racks, and other similar stowage locations for life-saving equipment are not marked with symbols in accordance with the recommendations of the Organization, indicating the devices stowed in that location including, if more than one device is stowed, indication of the number of devices. (i.e. parachute flares and rockets)
	04.07.2024	1	MARPOL ANNEX V	The garbage management plan is not updated with the MEPC Circulars 277(70) and 295(71). The update of the aforementioned Plan dates back to MEPC Circular 219 (63).
		2	MARPOL ANNEX IV	Although the technical file of the engines are on board, the record books of the engine parameters are not recorded from 2022.
		3	STCW CODE PART A	Inconsistency detected between what is reported in the Deck Log-book regarding the ECDIS drills (06 and 09 June 2024) carried out on board compared to the rest and work hours records
		4	SOLAS CH. III	Fire and Solas Training Manuals are not customize to the ship. Addendum to the training manual made available and required info filled in
		5	SOLAS CH. III	Not updated
		6	SOLAS CH.V	On some days the signature of the officers in charge of duty is missing from the logbook.
		7	MARPOL ANNEX V	The Master's signatures have been missing from the garbage record book since 14 March 2024.
		8	SOLAS CH.II-2	Emergency escape in Emergency steering gear compartment was blocked with padlock.
		9	SOLAS CH.V	For intended voyage Savona - Chipiona Pilot Station: Mediterranean Pilot NP 45.
		10	SOLAS CH.V	For intended voyage Savona - Chipiona Pilot Station: Not up to Date 5 nautical charts; not installed 25 nautical charts.

		11	SOLAS CH.III	Crew members not familiar with procedures in case of fire (i.e one crew members dressed with fireman outfit had no air available in the cylinders, the same crewmember went to a different area than where the fire had been simulated and during the move he dropped the ax). Fire drill failed
		12	SOLAS CH.II-2	The closure of the fire damper of the toilet ventilation room cannot be closed from the main deck and there are no ladders or other safe methods to achieve an easy closure.
		13	SOLAS CH.V	The magnetic compass bulb does not work.
		14	SOLAS CH. XI-2	Details of non conformities specified in the security form as per MSC Circ. 1111 provided to Ship's Master.
SAVONA	08.01.2025	1	SOLAS CH.III	Sb side lifeboat- Forward and astern propulsion- clutch control cannot be engaged
		2	SOLAS CH.V	ECDIS- Some nautical charts for the next intended voyage not updated
		3	SOLAS CH.II-1	Management plan for inspection and maintenance of mooring equipment-inventory and mooring line records- some inventory items and records not properly filled in
		4	MARPOL AMEND VI	DG N1 F.O. injection pump nr. #1#2#3#4#5#6 IMO nr. ID not properly redeable; DG N2 F.O. injection pump nr. #1#2#3#4#5#6 IMO nr. ID not properly redeable; F.O, injection pump spare part IMO nr. ID not properly redeable.
		5	MARPOL AMEND VI	M.E. cylinder head nr. #1#2#3#4#5#6 IMO nr. ID not properly redeable;
		6	MLC TITLE 4	Boiler; hot water leakage collected within can; unsafe for safety passage.

BARI	14.09.2022	1	C XI-1 R5	Not found on board Form 2-3 of CSR no 4/9 and Form 1 fo CSR no 8/10.
		2	CII-2 R14	Some self closing fire doors didn't close properly (B-deck stairways C-deck stairways, cable room)
		3	MLC A3.1	Extractor duct of galley found dirty.
		4	C V R 12	Standart magnetic compass found not clearly readable.
		5	MARPOL	Not all crew was familiarized with garbage management plan.
POZZALLO	30.09.2022	1	MLC A4.3	Rubber mats in front of high-voltage electrical panels non-compliant.
		2	CV R 27	List V – List of Ship Stations and Maritime Mobile Service Identity Assignments 2022 editions not on board.
		3	CV R27	Natical charts Nr. 2124 not up to date.
		1	MARPOL ANNEX IV	The rate of discharge not be approved by the Administration (only approved by Classification Society)
		2	SOLAS CH. I	The Record of equipment for Cargo Ship Safety Radio (Form R) indicate MF radio Installation on board instead of MP/HF. Found on board MF/HF radio installation as per Ship Station License
		3	SOLAS CH.II-2	The doors of the stairways in the divisions Class “*A” of are not steel or equivalent material.
		4	MLC	MLC complaint procedures were not found on bear

	30.12.2024		TITLE 5	
		5	SOLAS CH.II-2	An opening has been found along the internal bulkhead between the galley and the crew mess room. There is no evidence that the bulkheads are still in class A division.
		6	SOLAS CH. V	The navigation plan for the port of Pozzallo does not provide for berth to
		7	SOLAS CH.II-1	The HMI report indicates asbestos on board, but no monitoring and maintenance plan has been prepared Identification labels have not been placed
		8	SOLAS CH.II-1	Unsafe electrical outlets in crew mess room
		9	SOLAS CH.II-1	Automatic shut-off arrangements (OMD) was found inoperative. The air pipe was found broken
		10	COLREG PART C RULE 20	navigation light pannel not properly maintained.
		11	SOLAS CH. III	During fire drill nobody has checked the pressure of air bottle used by firemen.
		12	SOLAS CH.II-2	the heat detector in the galley has a cover that prevents its ordinary operation.
		13	ISM CODE SOLAS AMEND IX	Safety management audit by the Administration is required before departure of the ship. Deficiency(s) marked ISM is (are) objective evidence of a serious failure, or lack of effectiveness, of implementation of the ISM Code.
FALCONARA	20.12.2022	1	CII-1	No:2 emergency light found not working.
		2	MARPOL	Not evidence about approval of Administration of Stability Instruments.
GIOIA TAURO	05.01.2023	1	MLC 2006	Personal Equipment, During test of lowering Rescue Boat, some crew members didn't wear safety gloves.
		2	CII-2 R14.2	Fire detection and alarm system, one smoke detector in E/R, lower deck, port side inoperative.
		3	ISPS Code	Some restricted areas left open during cargo operations.
		4	MLC 2006	Hand rail on main deck (lashing area) starboard side is damaged.
		5	S CXI-1 R3	IMO number in E/R not permanently marked.
		6	ISM	Corrective action needed by company in 3 months.
	21.05.2025	1	SOLAS CH.III	Some lifejackets found worn out
		2	MLC TITLE 3	Galley's floor found dirty.

		3	MLC TITLE 4	Found an excessive amount of vapor escaping from pipes in purifier room.
		4	SOLAS CH.II-2	Found a fire hose holed. Spare one present on board.
		5	SOLAS CH.II-1	Presence of rust in various external parts of ship's main deck. Maintenance needs to be implemented.

GENOA	17.04.2023	1	MLC Title 4 Standart A4.3	Aft/forward mooring winches clutch lever safety pin missing. There is also evidence that pins are not used as necessary
		2	MLC Title 4 Standart A4.3	Railing and passage area on lashing platform between bays 34-30 damaged. Master standing order and risk assessment issued by Master. Master instructed to rectify within 14 days.
		3	SOLAS Ch.2-1 R.457 Part C,D,E,F	Several electrical plugs in deck area found without protective caps impairing IP protection. Deficiency related also to MLC area.
	23.04.2025	1	NOx Technical Code CH. 6	DDGG n. 1-3 - Record books of engine parameters not correctly filled in. For instance: fuel injection pump and plunger and barrel of fuel oil injection pump IMO ID.
		2	MARPOL ANNEX VI	DG n. 1 - fuel injection pumps IMO ID not always clearly readable; all plunger and barrel of fuel all injection pumps IMO ID inconsistent with NOx technical file: IMO ID 36.02 or IMO ID 36.04 instead of BF23FP2. DG n. 2 - fuel injection pumps IMO ID not always clearly readable. DG n. 3 - fuel injection pumps IMO ID not always clearly readable; n. 1, 3, 4, 6 plunger and barrel of fuel oil injection pumps IMO ID inconsistent with NOx technical file: IMO ID 36.04 instead of BF23FP2.
		3	ISM CODE / PART A / 1	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiency(s) marked ISM is (are) objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.
GAETA	18.07.2023	1	MARPOL AN.I/REG.37	Found on board SOPEP Plan with not update local contact
		2	SOLAS/REG.27	Nautical chart n. 1911 not update.
		3	SOLAS-REG.34	Prior to proceeding to sea, the master doesn't ensured that the intended voyage has been planned using the appropriate nautical chart.

MONFALCONE	26.04.2023	1	MLC 2006 / Std A3.1	Cook and Chief steward cabins: flooring damaged.
		2	MLC 2006 Title 4 / St A4.4	No:1 rope(aft) found worn out.
		3	SOLAS Ch II-2 / R.14.2	Fire pump No.1 : Pressure gauge inoperative
	23.04.2025	1	SOLAS CH.II-1	Tools to test manually operated call points not available on board at the time of the inspection.
		2	MLC 2006 TITLE 4	Rubber insulating mats: no evidence of IEC certification. Warning signs for electrical shock risk missing in some electrical panels powered with dangerous voltage.
		3	SOLAS CH.II-2	Quick closing valve No. 1 (HFO separator suction from HFO PS sertling tk): lever defective (not passible to keep in open position).
		4	MLC 2006 TITLE-3	Passenger cabins found dirty and with some fittings/appliances broken/damaged. Sanitary facilities not hygienic. Muster instructed put the cabins out of action until they were restored (at the time of the inspection ship doesn't carry any passenger)
MARSALA	16.08.2023	1	SOLAS CH.IV-REG.7.1.3	The search and rescue locating device doesn't operate properly
		2	SOLAS CH.II-2/REG.13.1	Escape routes from Engine Room not marked.
		3	ICLL 2003/AN. I/REG.16	The hatch cover on the galley top not weathertight.
CHIOGGIA	05.09.2023	1	ISM CODE/PART A/1	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiency(s) marked ISM is (are) objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.
		2	MLC/TITLE 3/STD. A3.2	Several packages of food in the food store found expired.
		3	SOLAS/CH II-2/REG. 14.2	The escape way from the forecastle is not properly marked (Escape from the emergency fire pump local missing)
		4	MLC/TITLE 4/STD. A4.3	Some mooring ropes found in poor concitions.
		5	SOLAS CH.III/REG.6.2.1	The two way comunication equipment found with inoperative batteries in order to test the equipment, emergency batteries were used by the crew removing the non replaceable seal.
		6	SOLAS/CH.III/REG.19	No evidence found concerning the manoeuvring in the water of the rescue boat during the abandon shi drill carried out in March 2023. Master Instructed to carry out drills according Solas regulations and to record the activities accordingly.
		7	MLC TITLE/ STD. A2.1	The O/S Seafarer Employment Agreement expired on 03.09.2023. A new one found onboard but only in copy and not signed at all.

MILAZZO	27.09.2023	1	MARPOL/REG.7	Found in the Supplement to the IAPP Cert. wrong serial number of Main Engine.
		2	SOLAS/CH. II-1/REG.26	At the time of inspection the diesel uauxiliary generator no 1 was found out of order. During the inspection the flag dispensation letter was received.
		3	ISPS CODE/PART A/7	Access control to ship: found some external doors to access restricted area open and/or not monitored (Garbage Room, Battrry Room Dry Provisions Store Paint Loker, Bosun's Store). Master and Sso was been instructed to kept close external doors to access restricted area or monitored by crew. A security meeting must be carry out by Master and Sso before departure with all crew member involved in secuntty duties.
		4	ICLL/REG.18	Found the door of external access to Dry Provision Store not properly secured
		5	MLC/STD. A3.1	Found the filters of the air conditioning system, in the air conditioning station, dirly
		6	SOLAS/CH.II-2-REG.9.4.2	Found in galley 3 fire doors (sell closing type) with hooks.
		7	SOLAS/CH.II-2-REG.14.2	During The inspection, fire höse no. 10, located in the Bosun Store, was found blocked by on board material.
		8	SOLAS/ CH.II-1/REG.44	During the PSC inspection two emergency lights were found with one non-functioning neon (Emergency Generator Room and on main deck near stb lifeboat).
		9	MLC/ STD. A3.1	During the PSC inspection the hospital was found occupied by a ship inspector.
		10	ISM CODE/PART A/1	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiency(s) marked ISM is (are) objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 monts from the final date of the report.
		11	SOLAS/CH.II-2/REG.14.4	During the PSC inspection, fan no. 1 was found out of service and undergoing extraordinary maintenance. ABS survey was released upon restoration of fan #1. See supporting document.
MARINA DI CARRARA	08.01.2024	1	SOLAS CH. II-2	Two fire hoses found holed.
	08.01.2024	2	OTHER CONVENTIONS-PARIS MOU TEXT-ANNEX 1	Steering room unsafe, due to the presence of provisional walkways realized with wooden axis above empty drums.
		3	MARPOL ANNEX V	Some garbage found collected outside appropriate receptacles due to insufficient collection capacity for the intended voyage.
PALERMO		1	SOLAS CH. XI-2	Custom police not logged in the gangway visitors' log. Muster instructed to properly log all visitors, including authorities, from now on.
		2	MLC 2006 TITLE 4	No adequate ventilation and protective curtain found at the welding area in the workshop.
		3	SOLAS CH. II-2	Heat detector in galley not operational
		4	MARPOL ANNEX V	GMP: no information about the maximum storing capacity of waste cooking oil

	23.04.2024	5	SOLAS CH. III	Fire drill in the galley was not satisfactory: no patrol went and check the area involved, fire door was left open and ventilation active. Some information were not reported to the Master on the bridge (i.e. air bottles' pressure). After the Master took a safety meeting with all the crew, the drill was repeated with satisfactory outcoming.
		6	ISM CODE / PART A / 1	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiency(s) marked ISM is (are) objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.
ORTONA	23.05.2024	1	MARPOL Annex V / R. 13	Original EIAPP Certificate (plus NOX TF) for generator (D2866LXE30) is missing on board. There is only evidence of the certificate released by ABS on 20th Nov 2014 by a screenshot showed by Master.
		2	SOLAS CH.III / R. 13	After abandon ship drill, during recovering operations of the STB lifeboat, there was a problem for securing the aft arm of gravity davit (it was impossible to fix the bolt in the holes). During subsequent manual operations a pulley broke completely.
		3	MLC TITLE 3 / STD. A3.1	In some crew accomodations some bed head lights were not properly safe and electric lines must be properly fixed.
		4	MLC TITLE 3 / STD A3.1	Common sanitary facilities (WC and wash basins) and showers are not properly maintained (Floor damaged, water filters obstructed, general cleanliness, shower hoses and shower heads broken, hot water pressure insufficient).
		5	ISM CODE / PART A / 1	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiencies marked ISM are objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.
CATANIA	01.04.2025	1	MLC 2006 TITLE 3	Into two refrigerators in provisional store meet, fish and bread are nol correctly segregated.
		2	MLC 2006 TITLE 3	Common toilelttes not hygienic
		3	SOLAS CH. V	Last passage plan was not signed by Chief Engineer as acknowledgement.
		4	MARPOL ANNEX V	Placard of garbage basket are missed in the officer's messroom
		5	STCW CODE PART A	On september of 2024 the work and rest hours log book not endorsed by the Seafarers.
LIVORNO	18.03.2025	1	SOLAS CH.II-1	Some gauges (water separator pressure, A/Es gauges, etc.) in E/R are not readable.
		2	ISPS CODE	Escape way from ECR to poop deck not marked as restricted area. Moreover, the handle necessary to open the hatch it's stored nearby.
		3	SOLAS CH.II-2	G/O Service tank QCV found lashed to its releasing mechanism.
		4	SOLAS CH.II-2	E/R workshop fire door's automatic closing device found damaged.
		5	MLC 2006 TITLE 4	Anti shock mat under FO filter high voltage panel missing.
		6	ISM CODE-SOLAS CH.IX REG.3	Corrective action taken on the ISM system by the Company is required within 3 months. Deficiencies marked ISM are objective evidence of a failure, or lack of effectiveness, of the implementation of the ISM Code. The ship will be eligible for reinspection after 3 months from the final date of the report.

