

Denetim Limanı	Den. Tarihi	Uzman (PSCO)	Type	Gross	Keel Date	RO		Eksiklik Maddesi	Ref.	Eksiklik Kodu
						Safety Cert.	SMS			
FALMOUTH	21.05.2018	M. ANDREWS	Other Cargo Ships	1488	20.04.1991	TL	TL	ME Room fire damper port not free to operate. (not as required)		17/10,
								Insufficient fresh provision on board. (Insufficient)		17
								Porthole (scuttle) in crew toilet port side unable to close correctly + make watertight seal. (Not as required)		17
								Provision room means of opening from inside broken (damaged)		17/10*
								Galley insufficient cleaning knife storage unhygienic +range uptake greasy (Not Hygenic)		17
								Serious main engine failure -camshaft completely failed. Repaires to be carried out to class requirements		17/99*
								3 toilets seats broken + not ready for use (damaged)		17
	7.12.2018	B.GILBERT/S.SUDGE	Bulk Carier	39555	08.02.1987	BV	BV	Quick closing valves failed to operate when tested.	SOLAS II-2 Reg. 14.1	17/10
								Emergency ligths not available in way of port side liferaft	SOLAS III / Reg.11.3	99
								Lagging on work wit E/R saturated with oil. Bilge to clean.	SOLAS II-2 Reg. 26	16
Oily water seperator not operated correctly solenoids valves not operated								Marpol Annex 1 Reg. 14	17	
TEESPORT	31.05.2018	R. JACKSON	General Cargo	8601	02.06.2008	FS/BV	TL	PSCO identity not requested or verified.	ISPS/A/7	17/10
								Safety Equipment Certificate Form E indicates sound reception system provided- Crew unable to find.	SOLAS 88/1/R14	16
								Safety pins left in CO2 bottles system would not operate.	SOLAS 99/00 II- /R.14.1	17/10
								Not all self closing fire doors close.	SOLAS 99/00 II- /R.9.4.2	17/10
								Sea rank not in english in the seafarers employments agreements.	MLC 2006/2/2.1	16
	21.04.2019	R. JACKSON	Bulk Carier	22458	20.06.2008	FS/TL	TL	Oil Record book N26 entries to be in tonnes.	Marpol 09 / I / R.17	10
								(Accidental Damage) Forecastle holed in several places railing missing deck buckled, Repair plan to submit to MCA	ICLL / 1988/ A / 15	17
								SCBA in forecandle leaks air.	SOLAS/99/00 II/2/10.10.2.1	17
								Numerous fire doors do not close.	SOLAS/99/00 II/2/9.4.2	17
								Upper Nuc light inoperative.	COLREG/C/ R20	10
Handle for freefall davit broken.								SOLAS/96/98 III/R16	10	
Liferaft transit bands not removed as required.								SOLAS/96/98 III/R13	10	
220 V feeder panel has earth fault.								MLC 2006 4/4.3	10	
No 2/3 hatch cover rams seal leaking.	ICLL / 03/ 13 / I / II / R.14	17								
Some mooring ropes have evidence of broken strands.	MLC 2006 4/4.3	17								

	24.06.2019	Asif HANIF	General Cargo	3726	10.10.2003	FS/RINA	TL	No english translation for records of daily hours of work and rest.	STCW A	17
								Corrective action on the ISM System is required within 3 months. Deficiencies marked ISM are objective evidence of a lack of implementation of the ISM Code. The ship will be eligible for re-inspection after 3 months.	SOLAS IX / R3	21
								Port gyro giving incorrect reading (top of wheelhouse)	SOLAS ch. V - Reg. 19.2.5	16
								Main engines emergency manoeuvring position instruction missing	SOLAS ch. II-1 Parts C, D, E, F /Reg. 26	16
								220V switchboard has insulation resistance reading below 1 M OHM	SOLAS II-1 R.45	17
6.07.2019	I. BELL	Other Cargo (Offshore)	2177	01.12.2007	ABS	ABS	Fire Doors self closing type not closing in numerous locations on ship.	SOLAS II-1 R.9.4.2	17	
							Accommodation air condition not working.	MLC 2006 3.1	17	
							Self closing soundig pipe without closing piece.	SOLAS II-2 R.4.2	17	
							MF HF Radio self test faulty.	SOLAS IV R.10	17	
HULL	10.06.2018	ALAN NAGLE	General Cargo	3720	10.10.2003	FS/BV	TL	Rescue boat painter quick realse device siezed.	SOLAS III/R.31.2	17
								Emergency lighting at emergency switchboard not working.	SOLAS II-1/R.43.2	17
								Insruction on the use of cargo fixed firefighting system lack detail on operation of the system i.e what valves to open and number of cylinders required.	SOLAS II-2 /R.10.7.2	17
								Watertight door to steering gear compartment from engine room cannot be dogged closed.	LL Anx. 1 R.12	17
								Accumulation of dirt noted under galley range, sink and workbench	MLC 2006 T.3 st. A.3.1	17
								Galley fire door not closing on self closing device.	SOLAS II-2 /R.14.2.1	17
BROMBOROUGH	30.07.2018	Z. HAQUNE/IAN HARVEY	General Cargo	2870	28.12.2008	FS	BV	Free doors to engine room purifier flat not closing latching	SOLAS II-2/R.9.4.2	17/10
								Faults on 2 phases F 230 V acc. Emergency switchboard	SOLAS II-1/R.45.3.2.3	17
								Crewmembers SEA Expired.	MLC 2006 Standart A.2.1	17/10
								Freeze temperature in alarm some frozen food found rotten.	MLC 2006 Standart A.3.2	17
SILVERTOWN	23.01.2019	R.SHAW / M.TOAMSON	Bulk Carrier	30085	04.04.2002	NK	NK	Sounding pipe self closing blanking devices found not in required position.	Solas Cph. II-2 Reg 4	17/10
								Self closing fire doors does not remains closed.	Solas Cph. II-2 Reg 4	17/10
								Exhaust cover missing from exhaust manifold.	Solas Cph. II-1 Reg 26	17/10
LIVERPOOL	8.05.2019	Z. HAQUNE/A HELHARD	General Cargo	5857	3.12.2008	LR	LR	The NUC Lights are only visible for about 30-40 degree on either side because cover plates are fitted for about 300 degree on each of the 4 lights. This prevents compliance with the all round requirement of Reg. 27 Photografic record taken.	COLREG/C/ R27	10

GARPOL	4.07.2019	MUHAMMED LQBAL	Bulk Carier	4807	25.12.2008	BV	BV	Muster List have not specified which officers are assigned to ensure that life-saving and fire appliances are maintained in good condition and are ready for immediate use. The muster list does specify substitutes for key persons.	SOLAS III/R.37	10
								Access to fire accomodation fire damper obstructed by storage box.	Solas Cph. II-2 Reg 14.2	10